All Recommendations

Thursday, October 04, 2012 8:29:26 AM

Record #	ABU	Unit	I/R	Item Nbr	Additional Consideration (Recommendation)	ABU Proposal	Resolution	Verifier Comments	Verifier Name	Verified On	Due Date	RR SOE	Assigned To	Status
16176	Cracking	FCC	2nd Revalid ation	failur perso Consi progr that a action 4Q05 Note: have	ern is that an expansion joint e has the potential to expose onnel to hot flue gas (~1200F). Ider completing the incress expansion joint study so any identified corrective in can be scheduled into the T/A. Two exp joints currently pressure in the annular e, which indicates an interior	Craig Dillon is currently in charge of project which includes replacement of expansion bellows during '05 Turnaround			Stock, Bryon D.	2/9/2006 <u>1</u>	12/15/2005	3 S	Stock, Bryon D.	Completed
16177	Cracking	FCC	2nd Revalid ation	Consi to val not b preci open AC no	ot implemented. Reval team urs with AC – remains open	Chain lock valves open and place information tags on valves not to close until other precipitator outlet valve verified open.	Valves have been chain locked open and information tags placed on valves not to close until other precipitator outlet valve verified open.	Verified that valves are chain- locked and tagged	Keaveny, Edward B.	5/26/2004		3 E	Elizalde, Mark T.	Completed
16178	Cracking	FCC	2nd Revalid ation	the si then suppl Consi Shutc note provi ramp consi to ma	ern is that the fire eyes "see" maller flame as a flameout, block-in the natural gas ly during rampdown. Ider modifyling the F-70 down procedure to include a to bypass the fire eyes, and de a safety watch, during down. Alternatively, der installing new fire-eyes aintain fuel supply during down.	Procedure revised, pressed 5/24/2004 (FCC-NP-4402)	Procedure revised, pressed 5/24/2004 (FCC-NP-4402)	Procedure revised, pressed 5/24/2004 (FCC- NP-4402)	Keaveny, Edward B.	5/25/2004		4 E	Elizalde, Mark T.	Completed
	1	Totals: 3 Records												